
ThermOmegaTech®

THERM-O-MIX® STATION

OPERATOR TESTING CHECKLIST

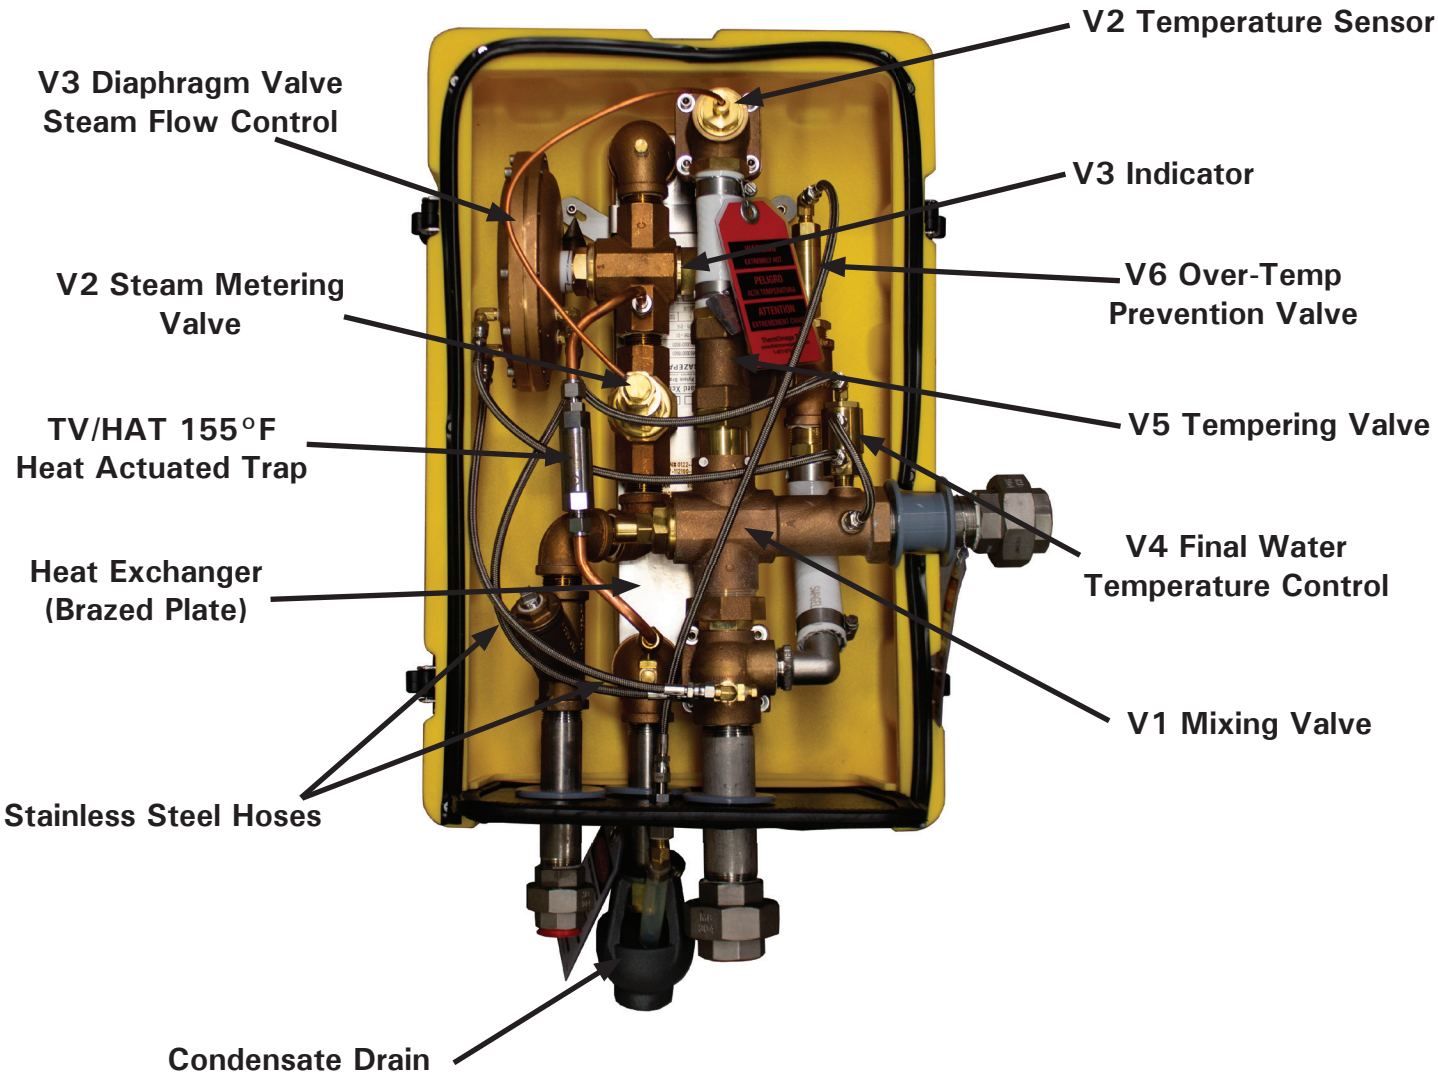

WARNING: Should a unit not pass any of the below tests, immediately remove the unit from service and contact ThermOmegaTech® at +1 (877) 379-8258.

THERM-O-MIX® STATION

OPERATOR TESTING CHECKLIST

STEP 1

Remove the Therm-O-Mix® station's front cover.

STEP 2

Check the condensate drain to confirm it is free of restriction and blockage. Some dripping from condensate drain is normal while the station is idle, but no steam should be seen.


STEP 3

Check yellow rubber hoses for signs of leakage and tighten clamps if necessary


STEP 4

Activate the shower and confirm V3 indicator moves to an open position. The indicator on V3 may take up to 15 seconds to begin to move after shower activation.

V3 INDICATOR CLOSED POSITION

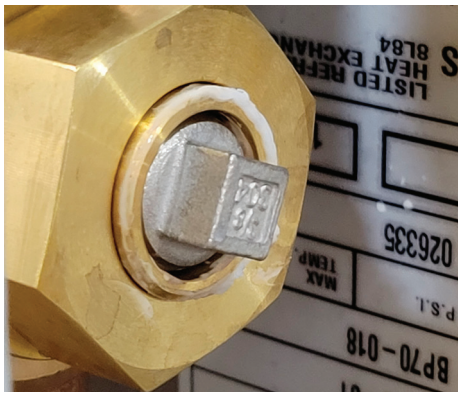

V3 INDICATOR OPEN POSITION

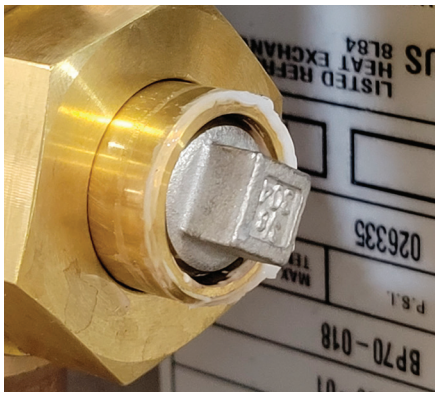

STEP 5

Check outlet temperature of shower using a thermometer to confirm proper operation. Thermometer should read 82°F (+/-5°F).

STEP 6

Shut off shower flow and confirm V3 indicator moved to closed position. Steam pluming from condensate drain is normal when shower flow stops. Once the V3 indicator has closed, confirm that no steam is coming from condensate drain before replacing cover.

STEP 7

Repeat steps 1-6 each time the shower is tested.

ThermOmegaTech®, Inc.
353 Ivyland Road
Warminster, PA 18974
1-877-379-8258
www.ThermOmegaTech.com

Because of continuous improvements, ThermOmegaTech®, Inc. reserves the right to change the design and specifications without notice